


USER MANUAL

3018 Pro MAX
CNC Router

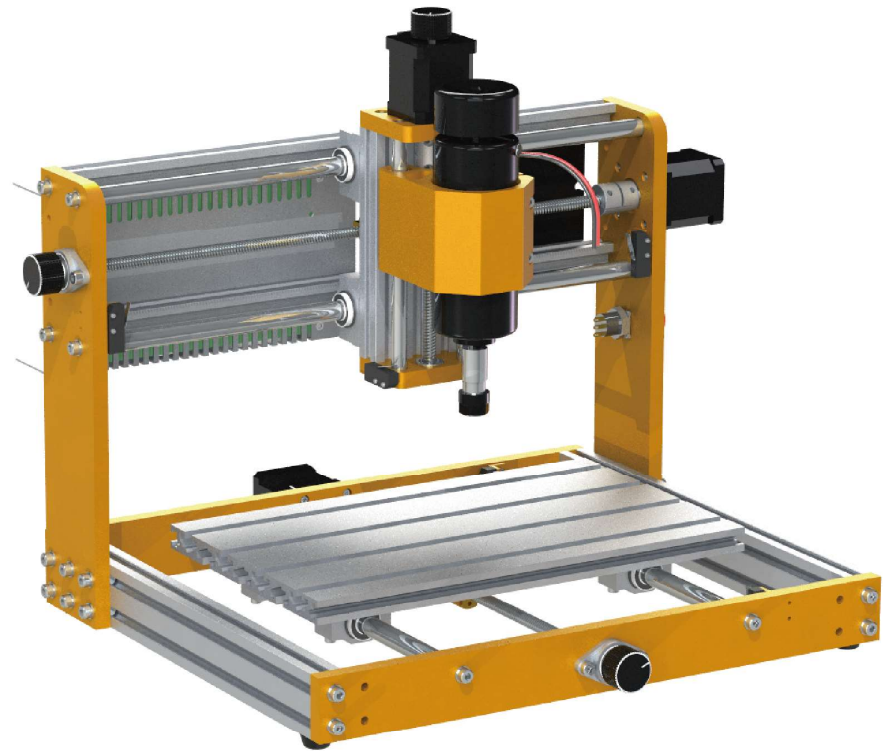

2023.4.4 V1.10

User Guide

Contents

Safety Guide	2
Specifications	3
Pack List	4
Package Content	6
Assembly instructions	8
1.Adjust the slider nut position	8
2.X Y Z module assembly	10
3.Install rubber feet	12
4.Install the X-axis limit switch	13
5.Install E-stop button	14
6.Spindle assembly	15
7.Install the spindle	16
8.Install the control panel	17
9.Install the power	18
10.Use the platen	19
Regular maintenance	20
Product diagram	22
Control board function diagram	23
Wiring diagram	24

Safety Guide



Please be careful when using your CNC machine. This machine is an electrical device with moving parts and dangerous areas.

1. The CNC Machine are for Indoor Use Only.
2. You must be 18 years or older to operate this machine, unless supervised by a knowledgeable adult familiar with the machine.
3. Wear the proper Personal Protection Equipment (Safety Glasses etc.).
4. Always place the CNC Machine on a stable surface.
5. The CNC Machine is supplied with Switchable Power Supply 230VAC or 115VAC. Never use a different power supply; it may cause malfunctions or damage to the machine.
6. The 3018 PRO MAX utilizes a high amp power supply. It is recommended that you do not plug the CNC Router into an extension cord, or power strip as it may damage the machine. (Need final confirmation)
7. Ensure the Emergency stop button is easily accessible at all times.
8. Never disassemble the Power Supply or Electrical Components. This will VOID the warranty.
9. DO NOT TOUCH the machine spindle, or place any body part near the working area when the machine is operating. Serious injury may occur.
10. DO NOT leave children unsupervised with the CNC Machine even when it's not operating. Injury may occur.
11. DO NOT leave the machine unattended while it's operating.
12. Ensure your CNC Machine is in a well-ventilated area. Some Materials may discharge smoke or fumes during operation.

Specifications


Work Area	300x180x78mm (11.81x7.08x3.07inch)
Drive Type	Chrome Plated Shaft & T-Shaped Screw Rod
Control Board	3Axis V5.2 GRBL 1.1f
Stepper Motor	nema17 42x48mm
Stepper Motor Drive	A4988
Spindle	φ52mm 500W 12000RPM
Power	48V 500W
Max Motion Speed	5000mm/min
Max Process Speed	2000mm/min
Max Accelerated Speed	200mm/s ²
Accuracy	±0.1mm
Limit Switch	Yes (X1, X2, Y1, Y2, Z1, Z2)
E-Stop	Yes
Z-Probe	Yes
Software	Candle
Laser	Support laser module with 40mm width 12V
Operating System	Windows XP/7/8/10 Linux
Overall machine size	485x415x374mm (19.09x16.34x14.72inch)
Machine Weight	11kg

◆ Pack List ◆

1. Y-Axis Module 1pc 	2. XZ-Axis Module 1pc 	3. Spindle 1pc 	4. Control Board 1pc 	5. Power 1pc 	6. Rubber Feet 4pcs 
7. Limit Switch 2pc 	8. Terminal 1pc 	9. ER11 1pc 	10. Collet 1pc 	11. Power Bracket 2pcs 	12. Auxiliary Tool 1pc 
13. E-Stop Button 1pc 	14. Thin Nut M16 1pc 	15. Spring Gasket 1pc 	16. O-Ring 1pc 	17. Gasket M5 12pcs 	18. Screw M5-16 12pcs 
19. Screw M5-10 4pcs 	20. Pan Head Screw M4-8 4pcs 	21. Pan Head Screw M4-6 4pcs 	22. Pan Head Screw M2-10 4pcs 	23. Wrench 4# 1pc 	24. Wrench 3# 1pc 

25. Wrench 2.5# 1pc 	26. Wrench 2# 1pc 	27. Wrench 1.5# 1pc 	28. Wrench 14/17# 1pc 	29. Screwdriver 1pc 	30. Z-Probe 1pc 
31. E-Stop Wire 1pc 	32. Wire Casing 1pc 	33. Power Wire 1pc 	34. USB Data Cable 1pc 	35. Motor Wire 3pcs 	36. Limit Wire 6pcs 
37. Spindle Wire 1pc 	38. Control Board Power Wire 1pc 	39. Cutter 1set 	40. Wire Holder 10pcs 	41. Platen 4pcs 	42. Lube 1pc 
43. USB Diske 1pc 	44. Braided Tube 1pc 	45. Brush 1pc 	46. Rule 1pc 	47. Ribbon 1pc 	48. User Manual 1pc 

Package Content

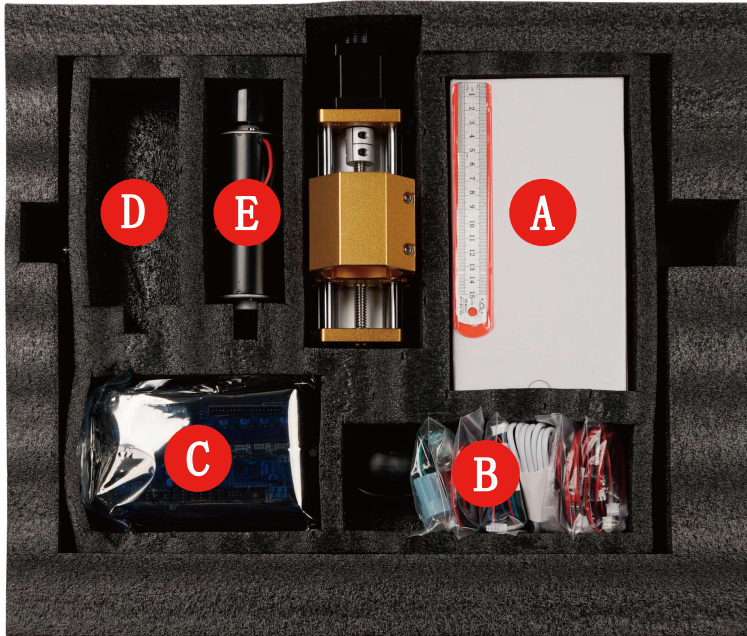


Parts box



- A** 5. Power 1pc
46. Rule 1pc
- B** 13. E-Stop Button 1pc
14. Thin Nut M16 1pc
15. Spring Gasket 1pc
16. O-Ring 1pc
30. Z-Probe 1pc
31. E-Stop Wire 1pc
33. Power Wire 1pc
34. USB Data Cable 1pc
35. Motor Wire 3pcs
36. Limit Wire 6pcs
37. Spindle Wire 1pc
38. Control Board Power Wire 1pc
- C** 4. Control Board 1pc
Parts box
- D** Laser (Optional)
- E** 3. Spindle 1pc

- F** 23. Wrench 4# 1pc
24. Wrench 3# 1pc
25. Wrench 2.5# 1pc
26. Wrench 2# 1pc
27. Wrench 1.5# 1pc
28. Wrench 14/17# 1pc
42. Lube 1pc
- G** 7. Limit Switch 2pc
11. Power Bracket 2pcs
- H** 6. Rubber Feet 4pcs
8. Terminal 1pc
43. USB Disk 1pc
- I** 17. Gasket M5 12pcs
18. Screw M5-16 12pcs
19. Screw M5-10 4pcs
20. Pan Head Screw M4-8 4pcs
21. Pan Head Screw M4-6 4pcs
22. Pan Head Screw M2-10 4pcs
40. Wire Holder 10pcs

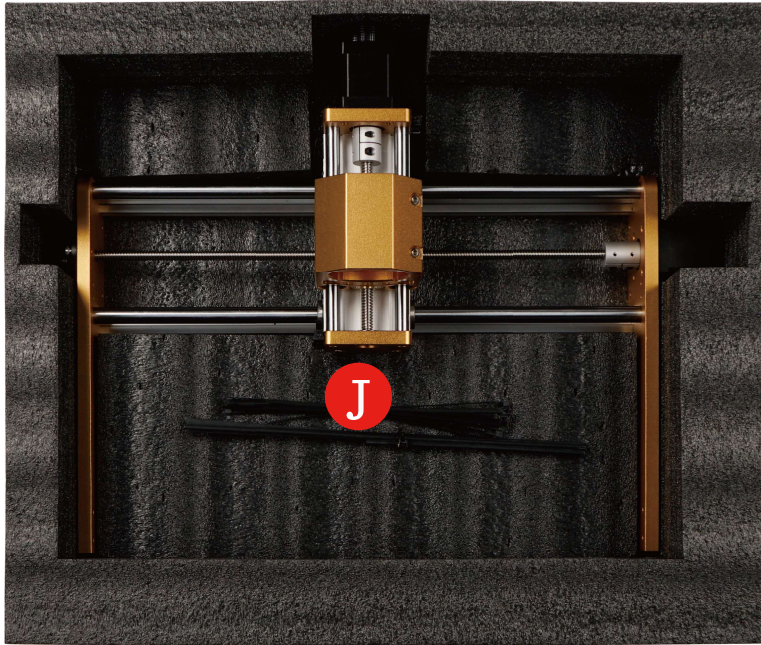

- J** 2. XZ-Axis Module 1pc
- 32. Wire Casing 1pc
- 47. Ribbon 1pc

Tip: When you cannot find the required part, you can find the location of the accessory in the packaging based on the name and serial number of the part. If not, please contact us





- K** 12. Auxiliary Tool 1pc
- 29. Screwdriver 1pc
- 45. Brush 1pc
- L** 9. ER11 1pc
- 10. Collet 1pc
- 39. Cutter 1set
- 41. Platen 4pcs
- 44. Braided Tube 1pc
- M** 1. Y-Axis Module 1pc






Assembly Instructions



1 Adjust the slider nut position

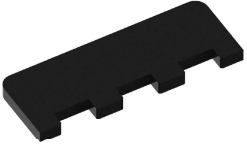Parts to be used	12.Auxiliary Tool 1pc	1.Y-Axis Module 1pc
		

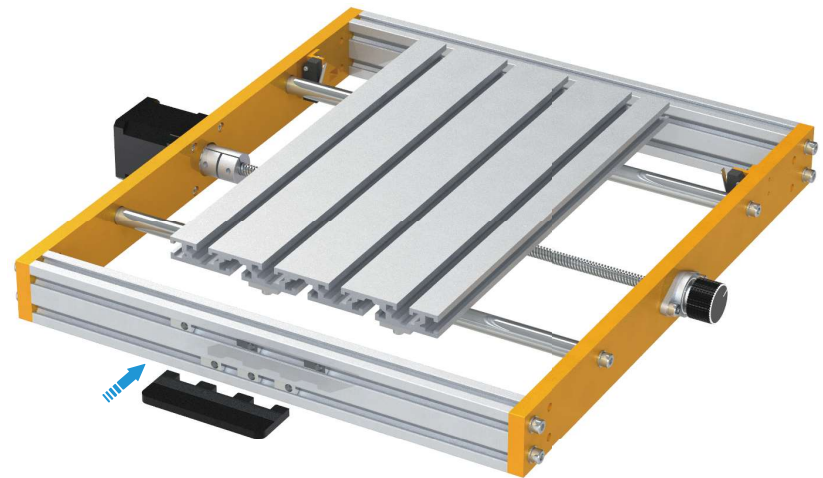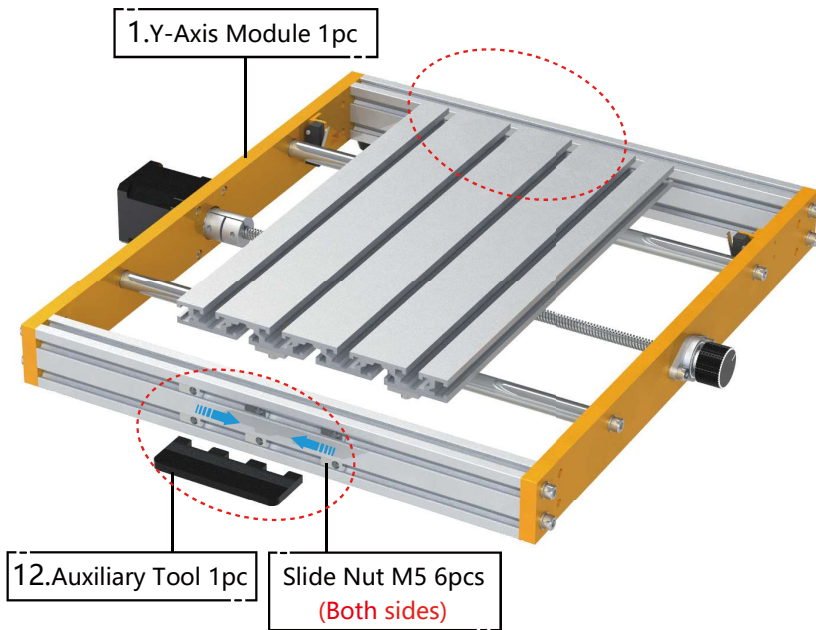

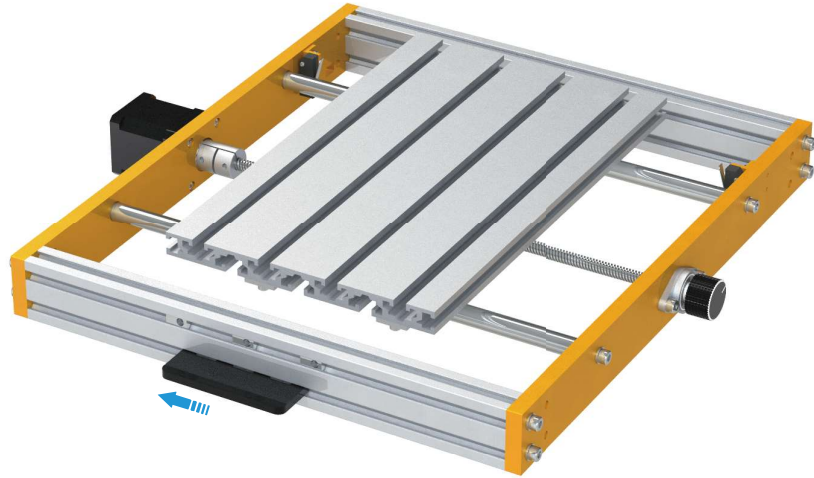


1




Tip: The auxiliary tool side is tightly attached to the aluminum plate

2

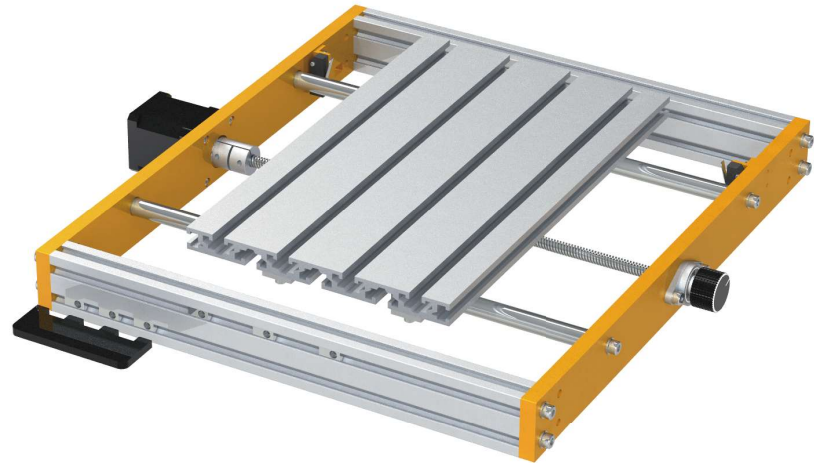



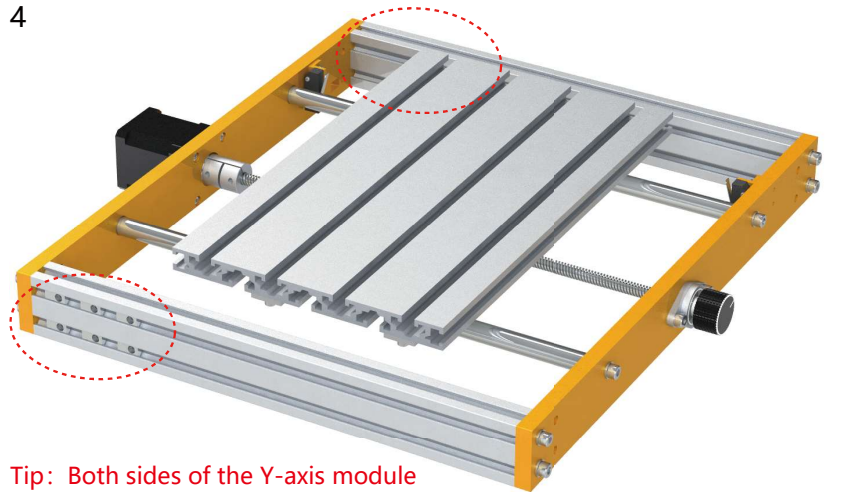


3

4




Tip: Both sides of the Y-axis module require adjusting the slider nut position

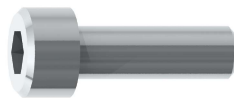
2 X Y Z Module Assembly

Parts to be used	1.Y-Axis Module 1pc	2.XZ-Axis Module 1pc	18.Screw M5-16 12pcs	17.Gasket M5 12pcs	23.Wrench 4# 1pc
					


Tip: The bottom surface of the aluminum plate of the XZ-axis module is flush with the bottom surface of the aluminum profile of the Y-axis module

Tip: Installation dimension of XZ-axis module and Y-axis module is 21mm

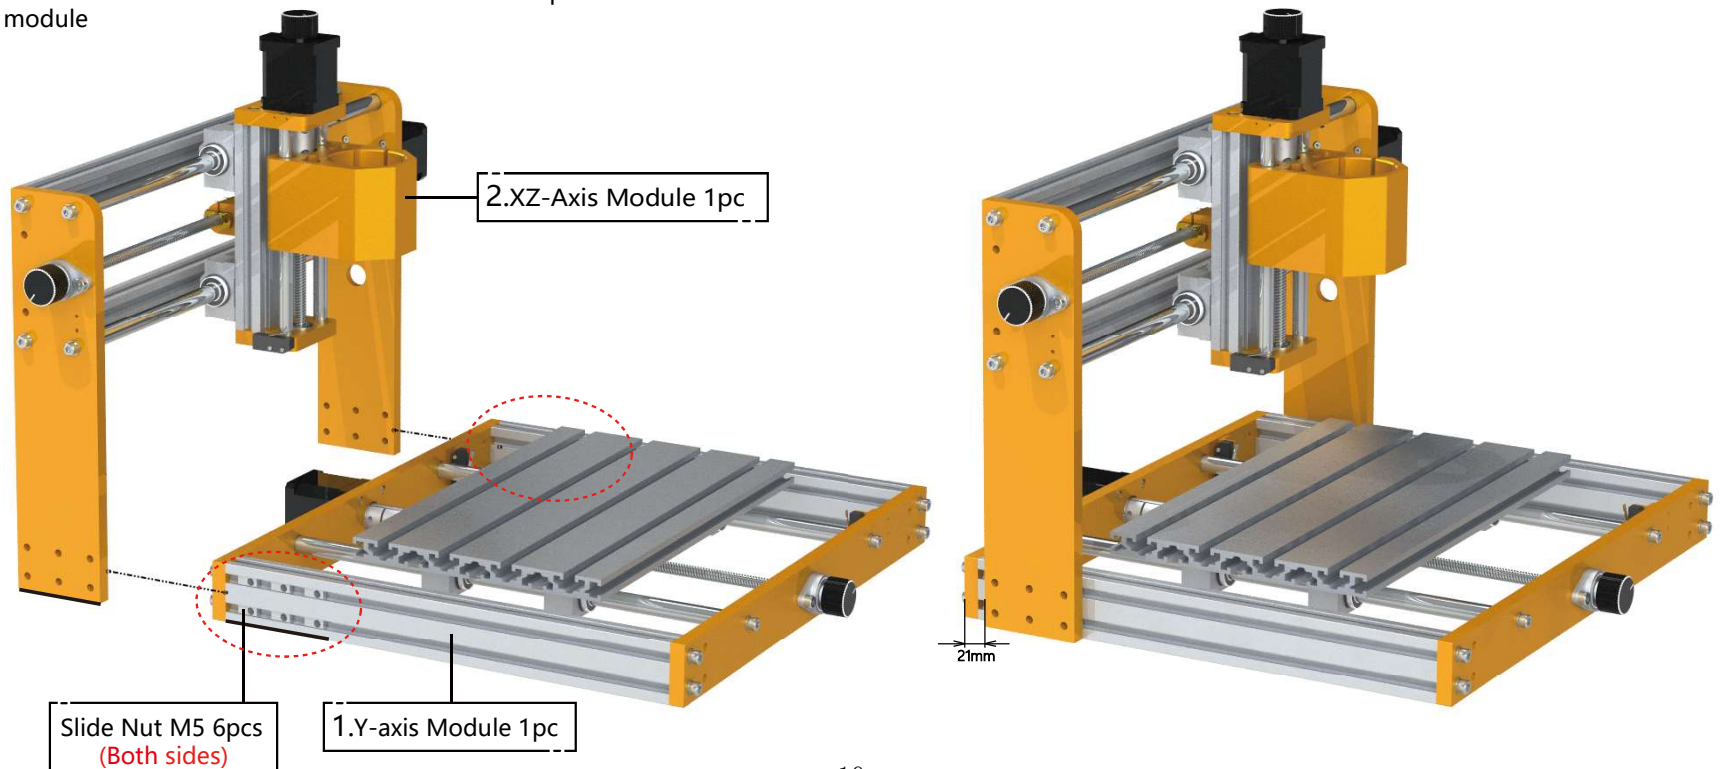

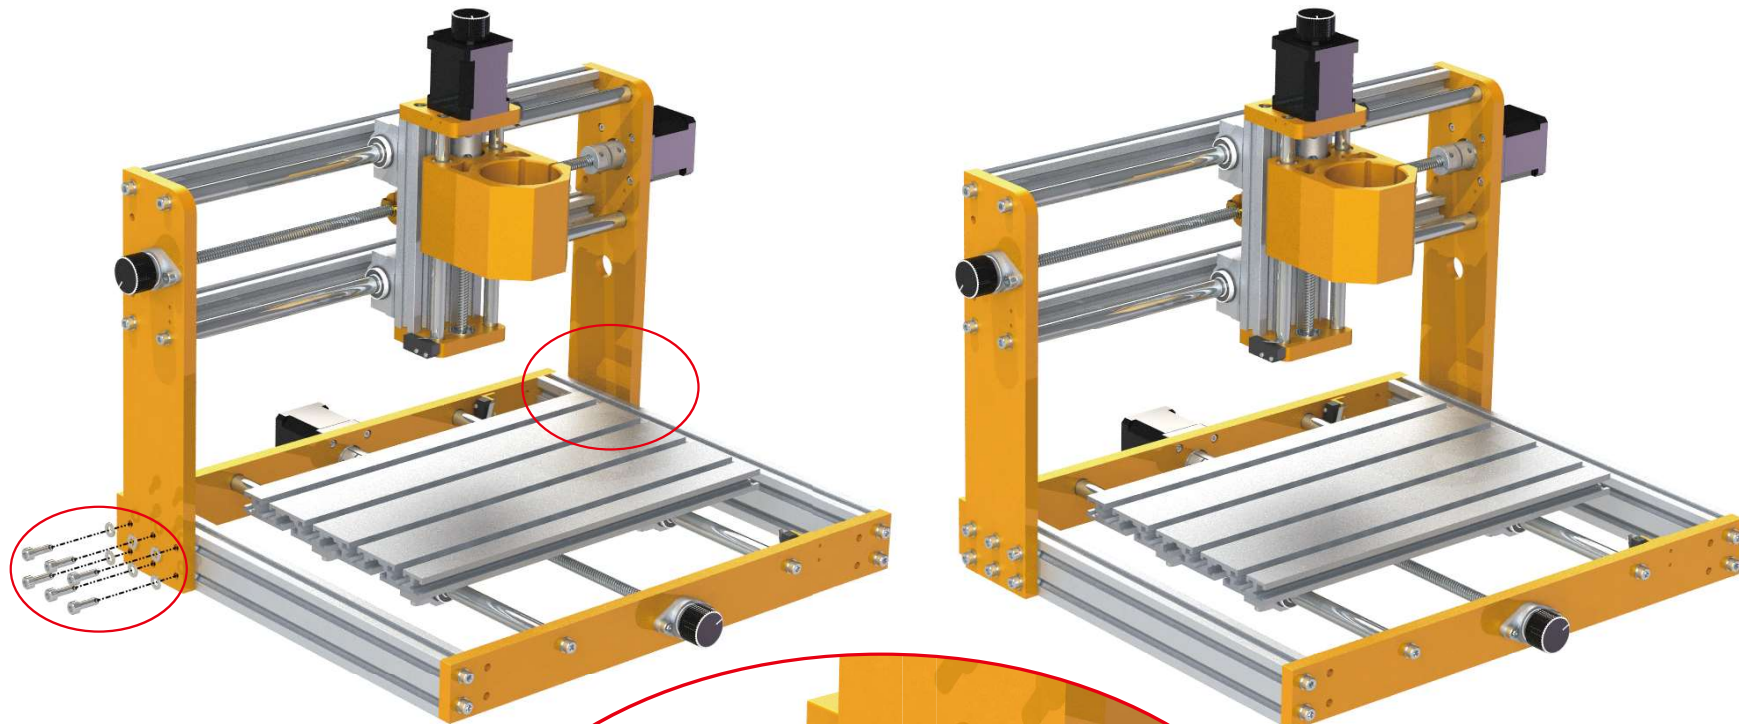

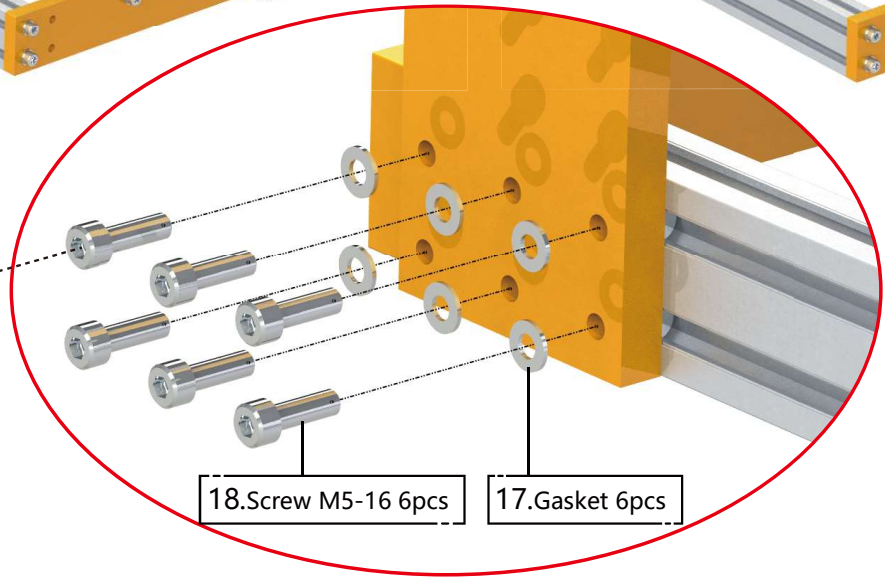


23.Wrench 4#




18.Screw M5-16 6pcs




17.Gasket 6pcs


3 Install Rubber Feet

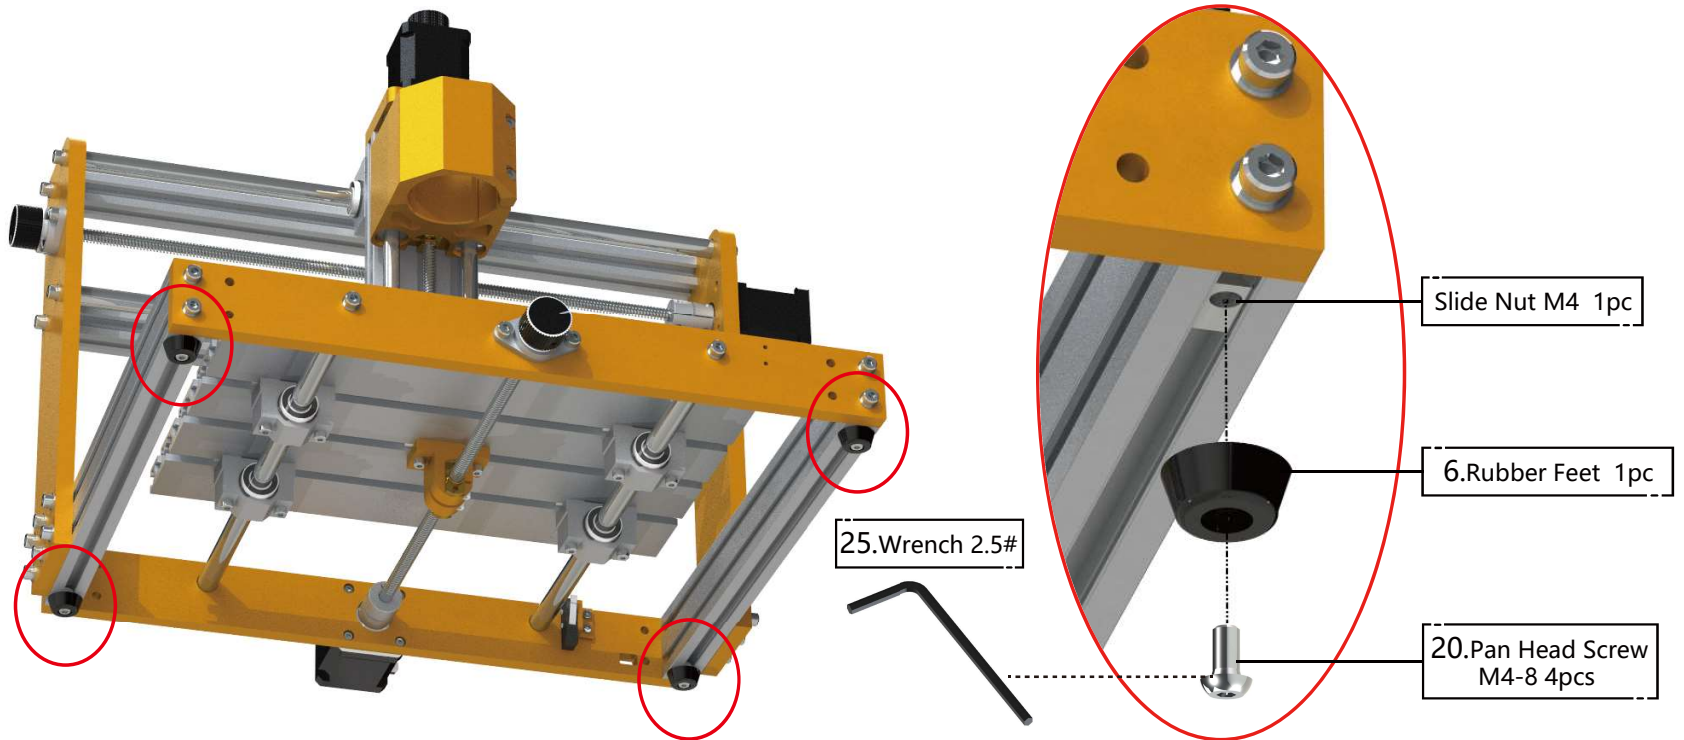Parts to be used	6.Rubber Feet 4pcs	20.Pan Head Screw M4-8 4pcs	25.Wrench 2.5# 1pc
			

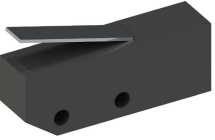


4 Install the X-axis Limit Switch



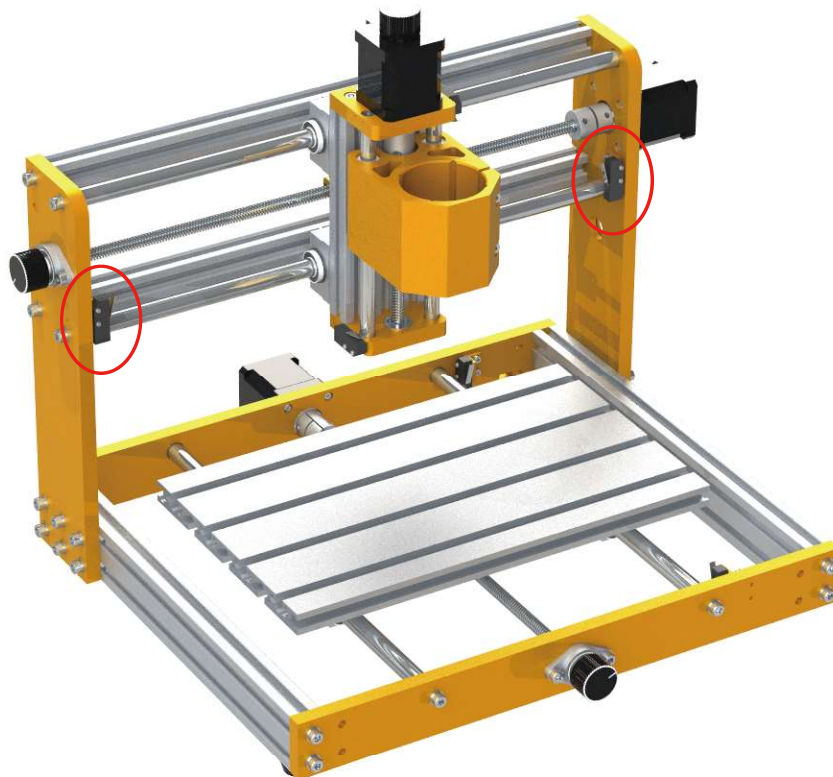


Parts to be used	7.Limit Switch 2pcs	22.Pan Head Screw M2-10 4pcs	27.Wrench 1.5# 1pc
			

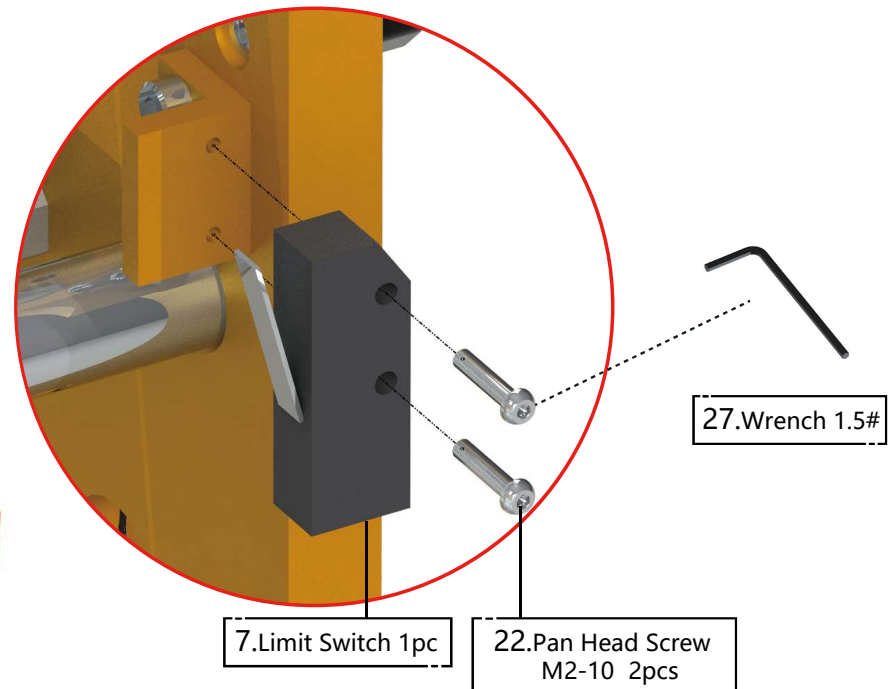



Tip: Limit switch socket position downward








5 Install E-Stop Button

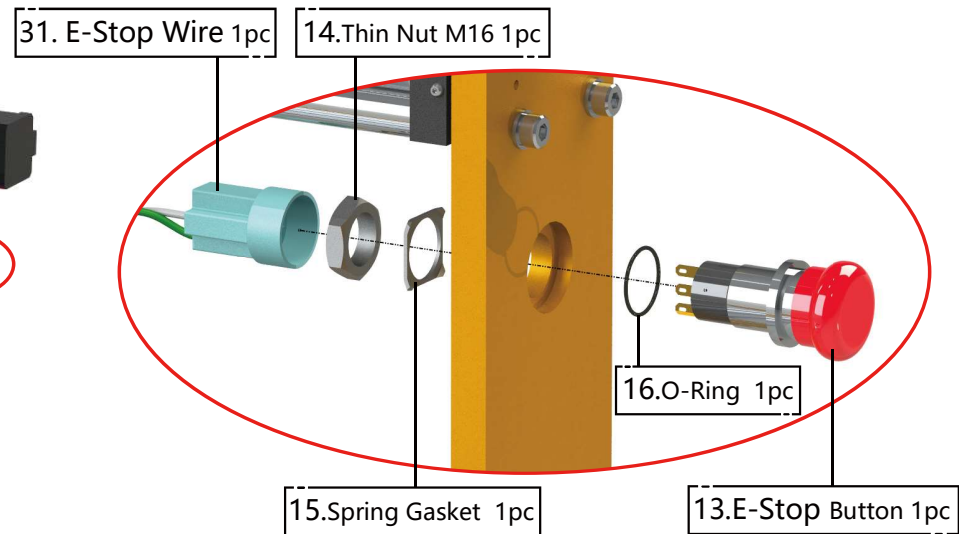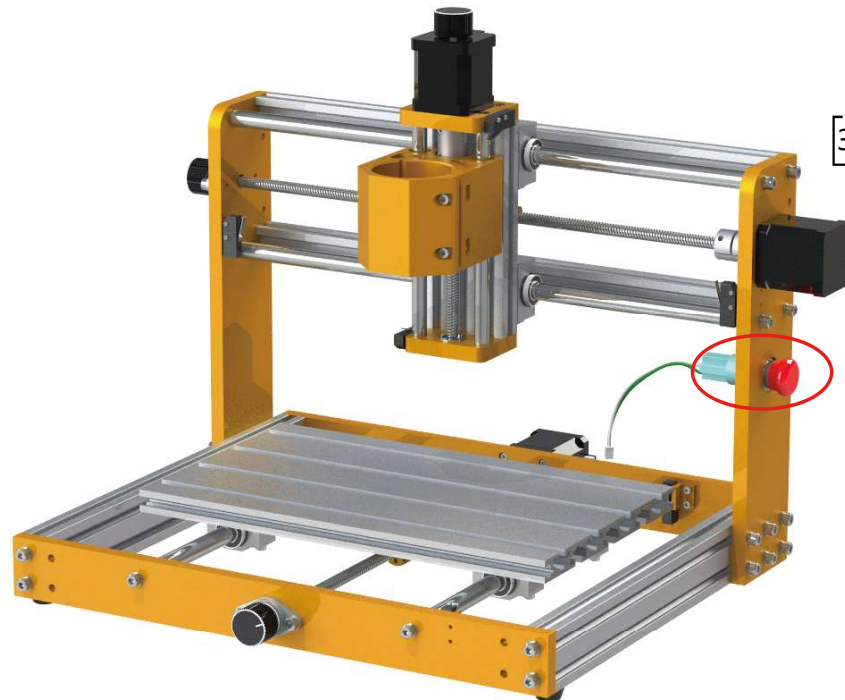
Parts to be used	13.E-Stop Button 1pc 	14.Thin Nut M16 1pc 	15.Spring Gasket 1pc 	16.O-Ring 1pc 	31. E-Stop Wire 1pc 
------------------	---	--	---	--	--

Tip: 1.The E-Stop Wire socket needs to be rotated to an appropriate angle to connect to the E-Stop Button
 2.Parts 13, 14, 15 , 16and31are in the same packaging bag



6 Spindle Assembly



Parts to be used	3.Spindle 1pc	9.ER11 1pc	10.Collet 1pc	26.Wrench 2# 1pc	28.Wrench 14/17# 1pc
					

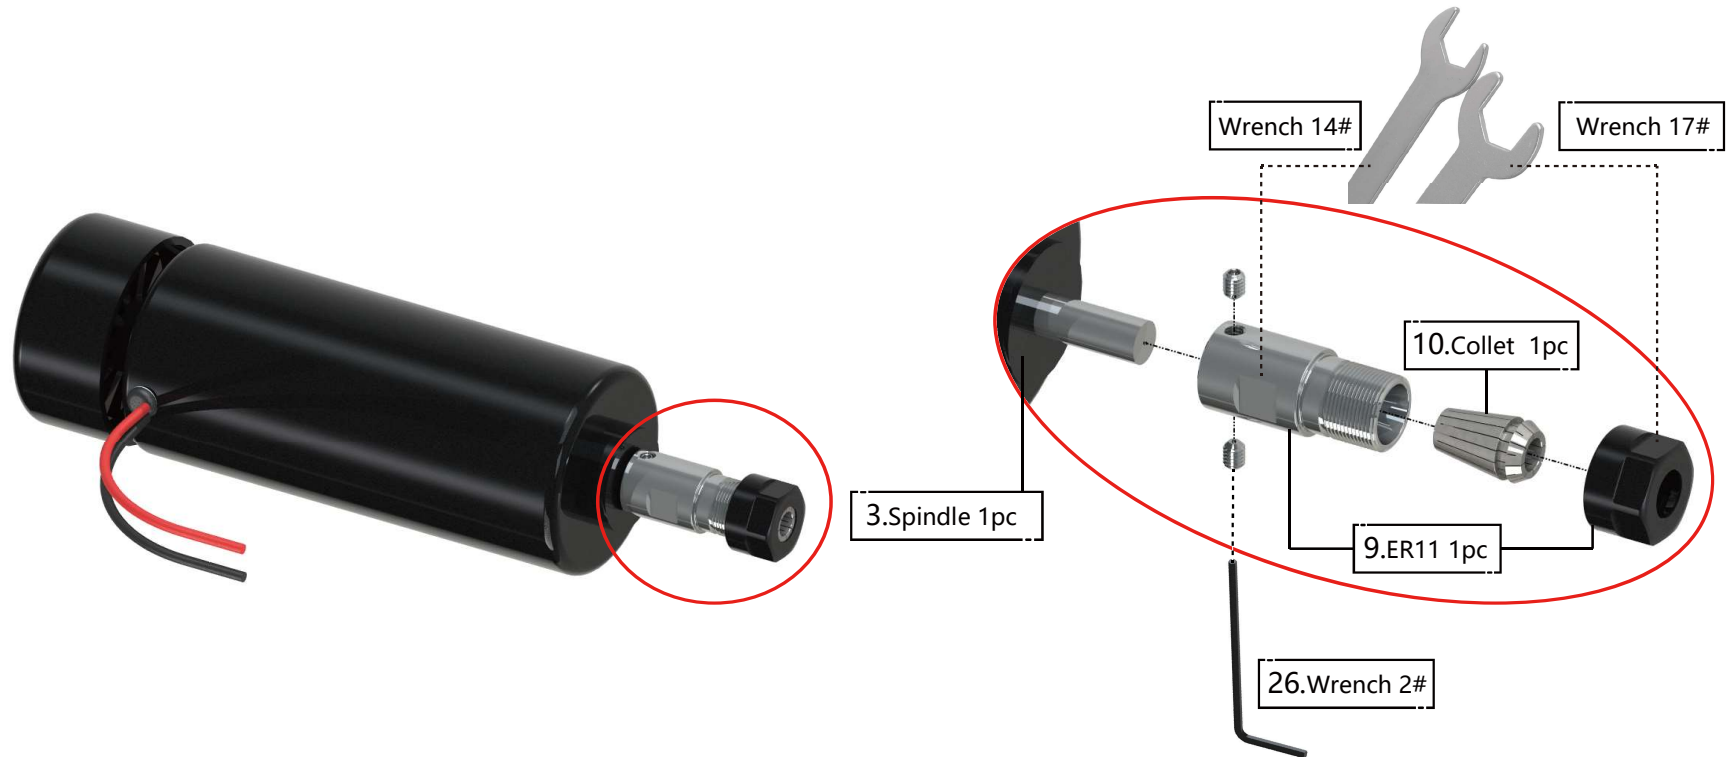


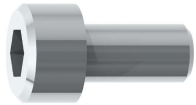

7 Install the Spindle



Parts to be used	3. Spindle 1pc	24.Wrench 3# 1pc
		

Tip: The optimal installation dimension is that the spindle protrudes 25mm from the spindle clamp

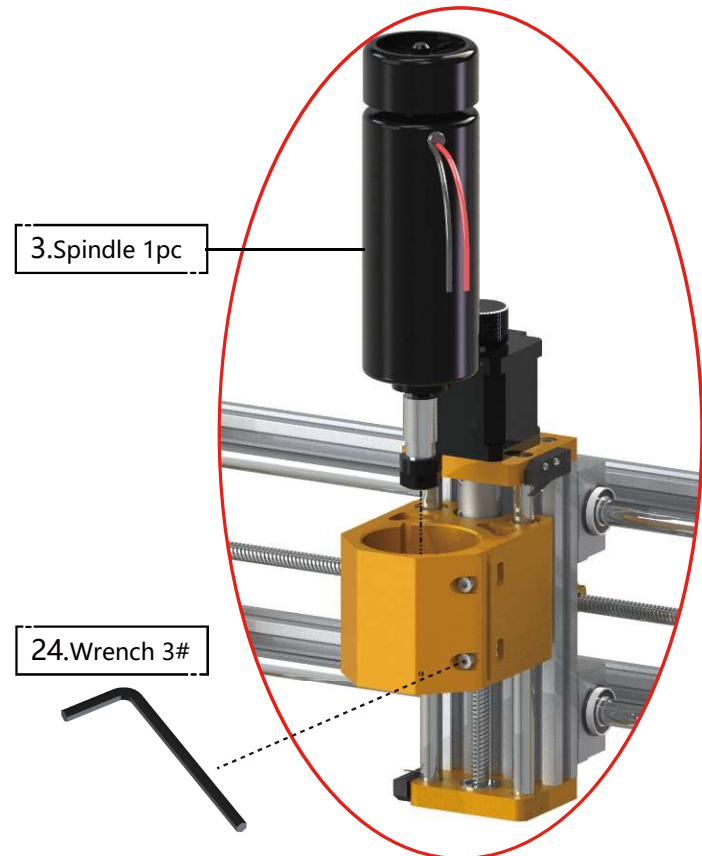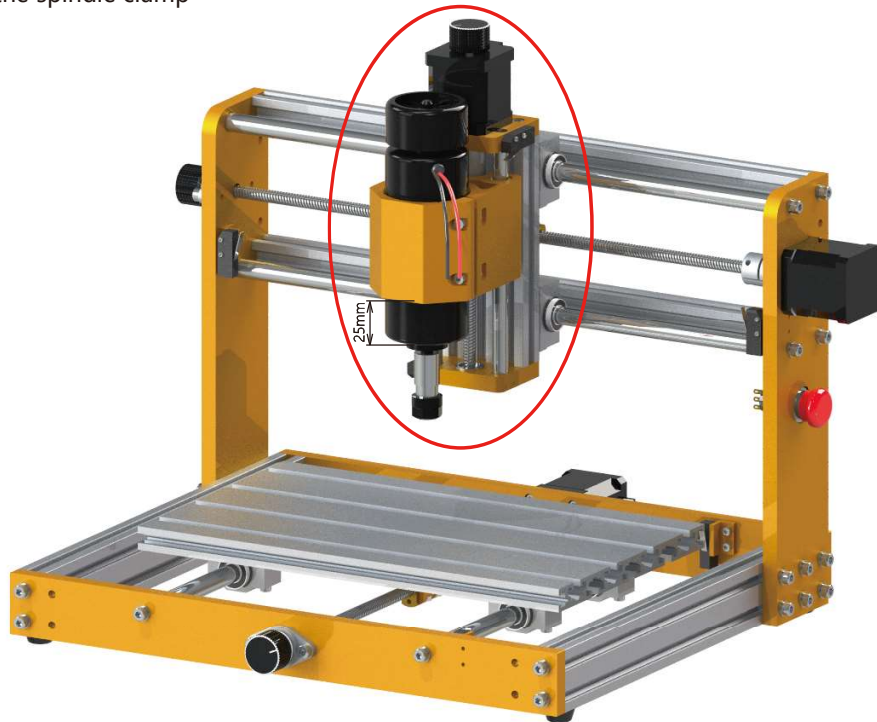





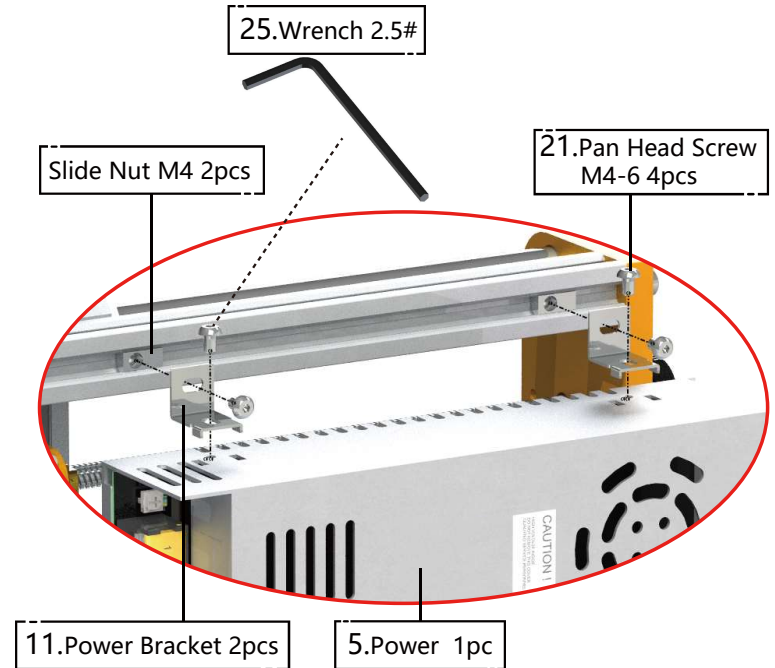
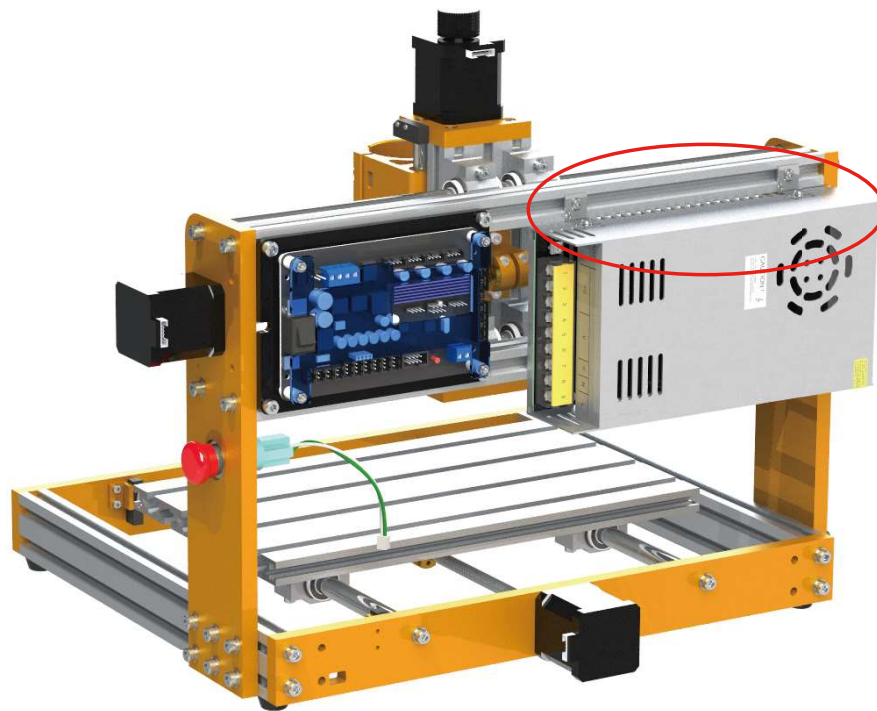
8 Install the Control Panel

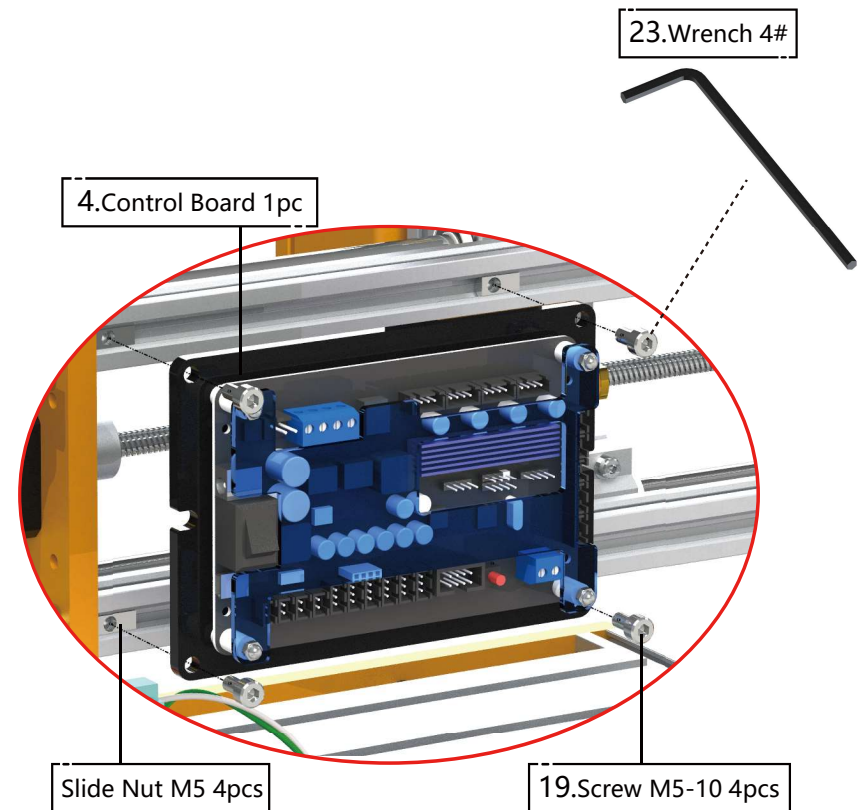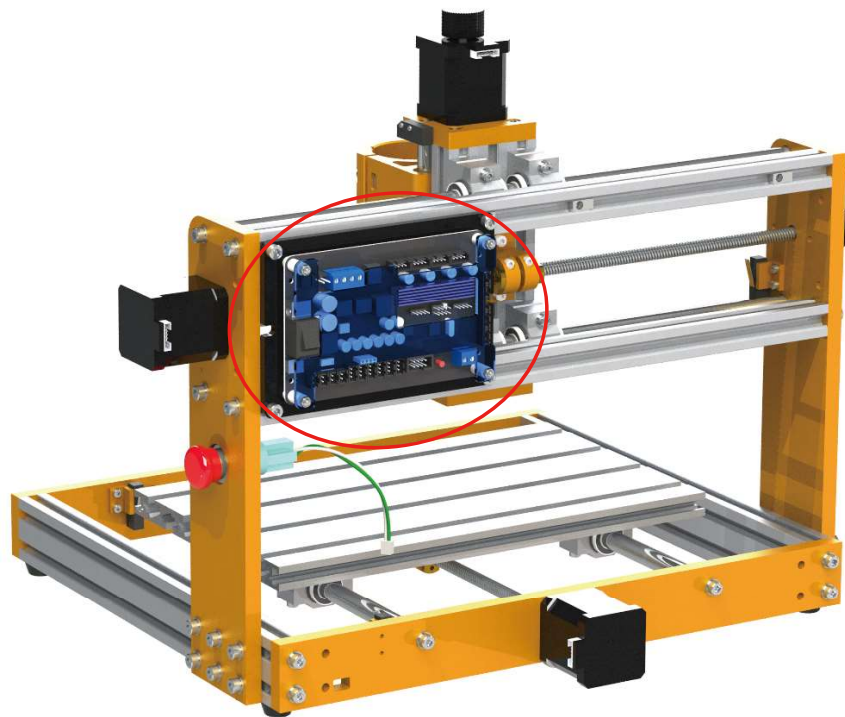Parts to be used	4.Control Board 1pc	19.Screw M5-10 4pcs	23.Wrench 4# 1pc
			



9 Install the power

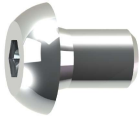
Parts to be used	5.Power 1pc	11.Power Bracket 2pcs	21.Pan Head Screw M4-6 4pcs	25.Wrench 2.5# 1pc
				



10 Use the Platen



Regular maintenance

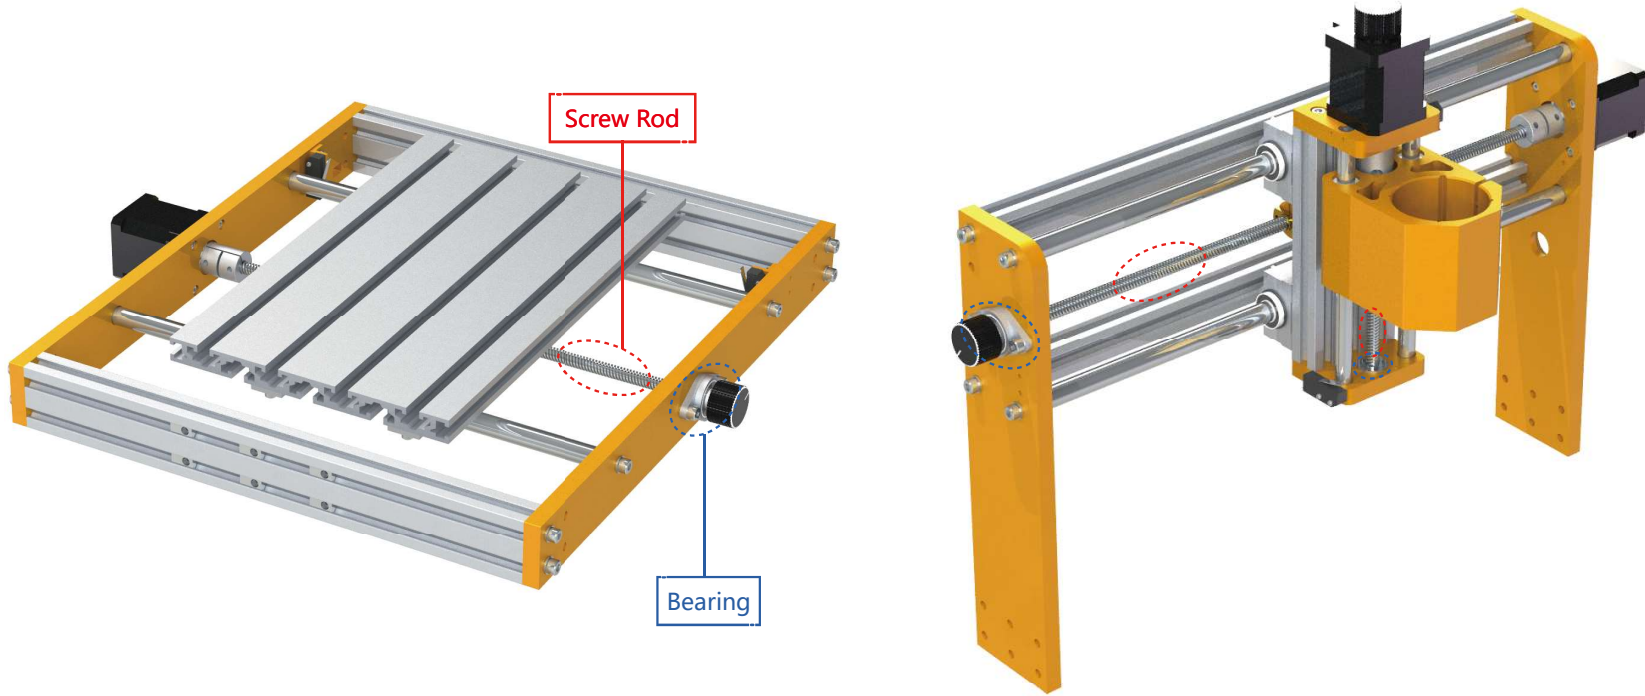


Tip: When the machine is just received, it is necessary to lubricate the screw rod, and bearing of the X, Y, Z axis with grease. After each use, it is also necessary to lubricate the machine, remove debris, and check whether the screws are loose



Lube




Brush

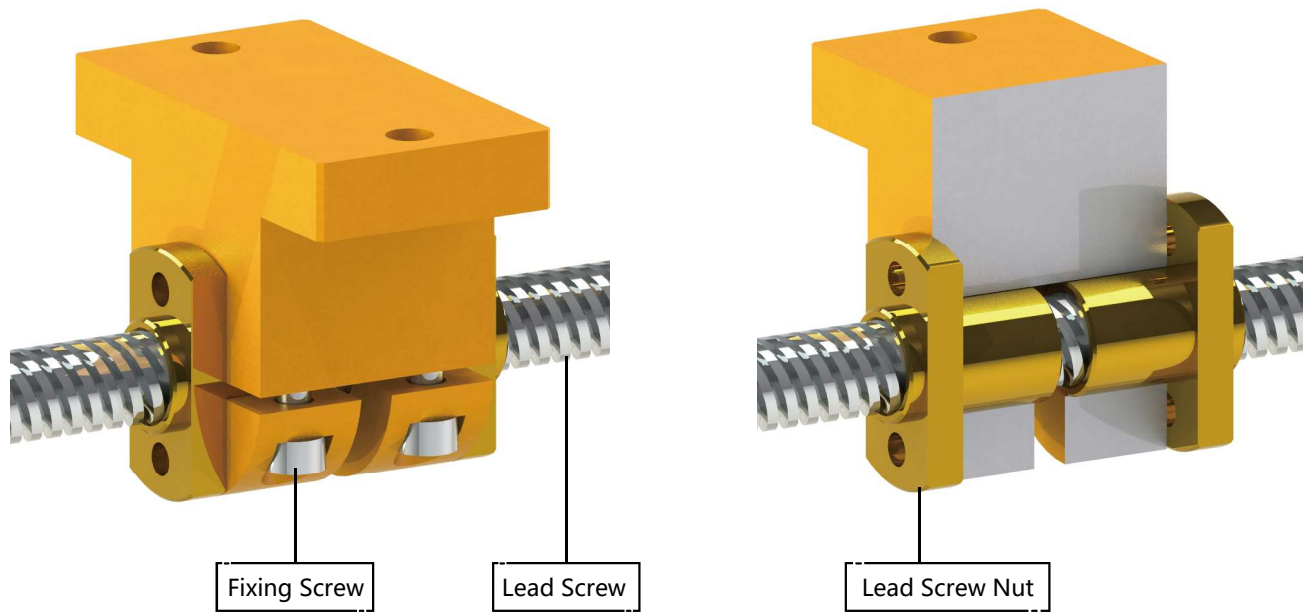


Tip: The double nut gap adjustment structure used for the X, Y, Z axis requires regular inspection of the clearance between the lead screw and the lead screw nut because the lead screw nut may be worn during use. Excessive clearance can reduce the machining accuracy of the machine. At this time, it is necessary to slightly loosen the fixing screw of a lead screw nut, then rotate the nut clockwise to adjust to the appropriate clearance, and then lock the fixing screw of the nut.

Product Diagram

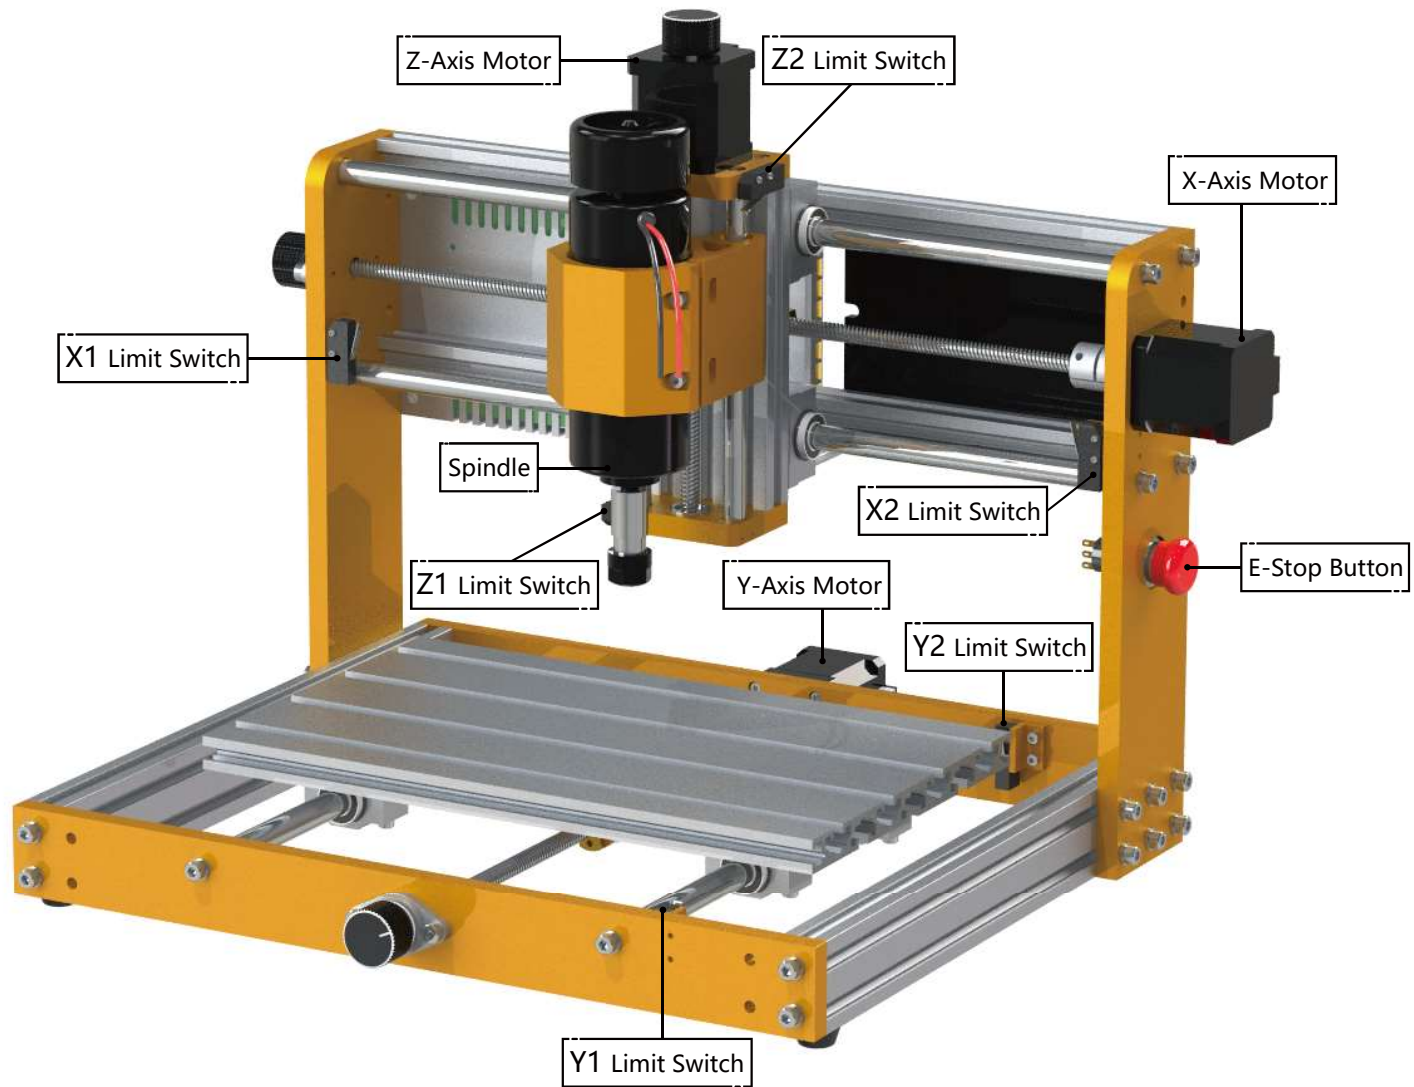

Control Board Function Diagram

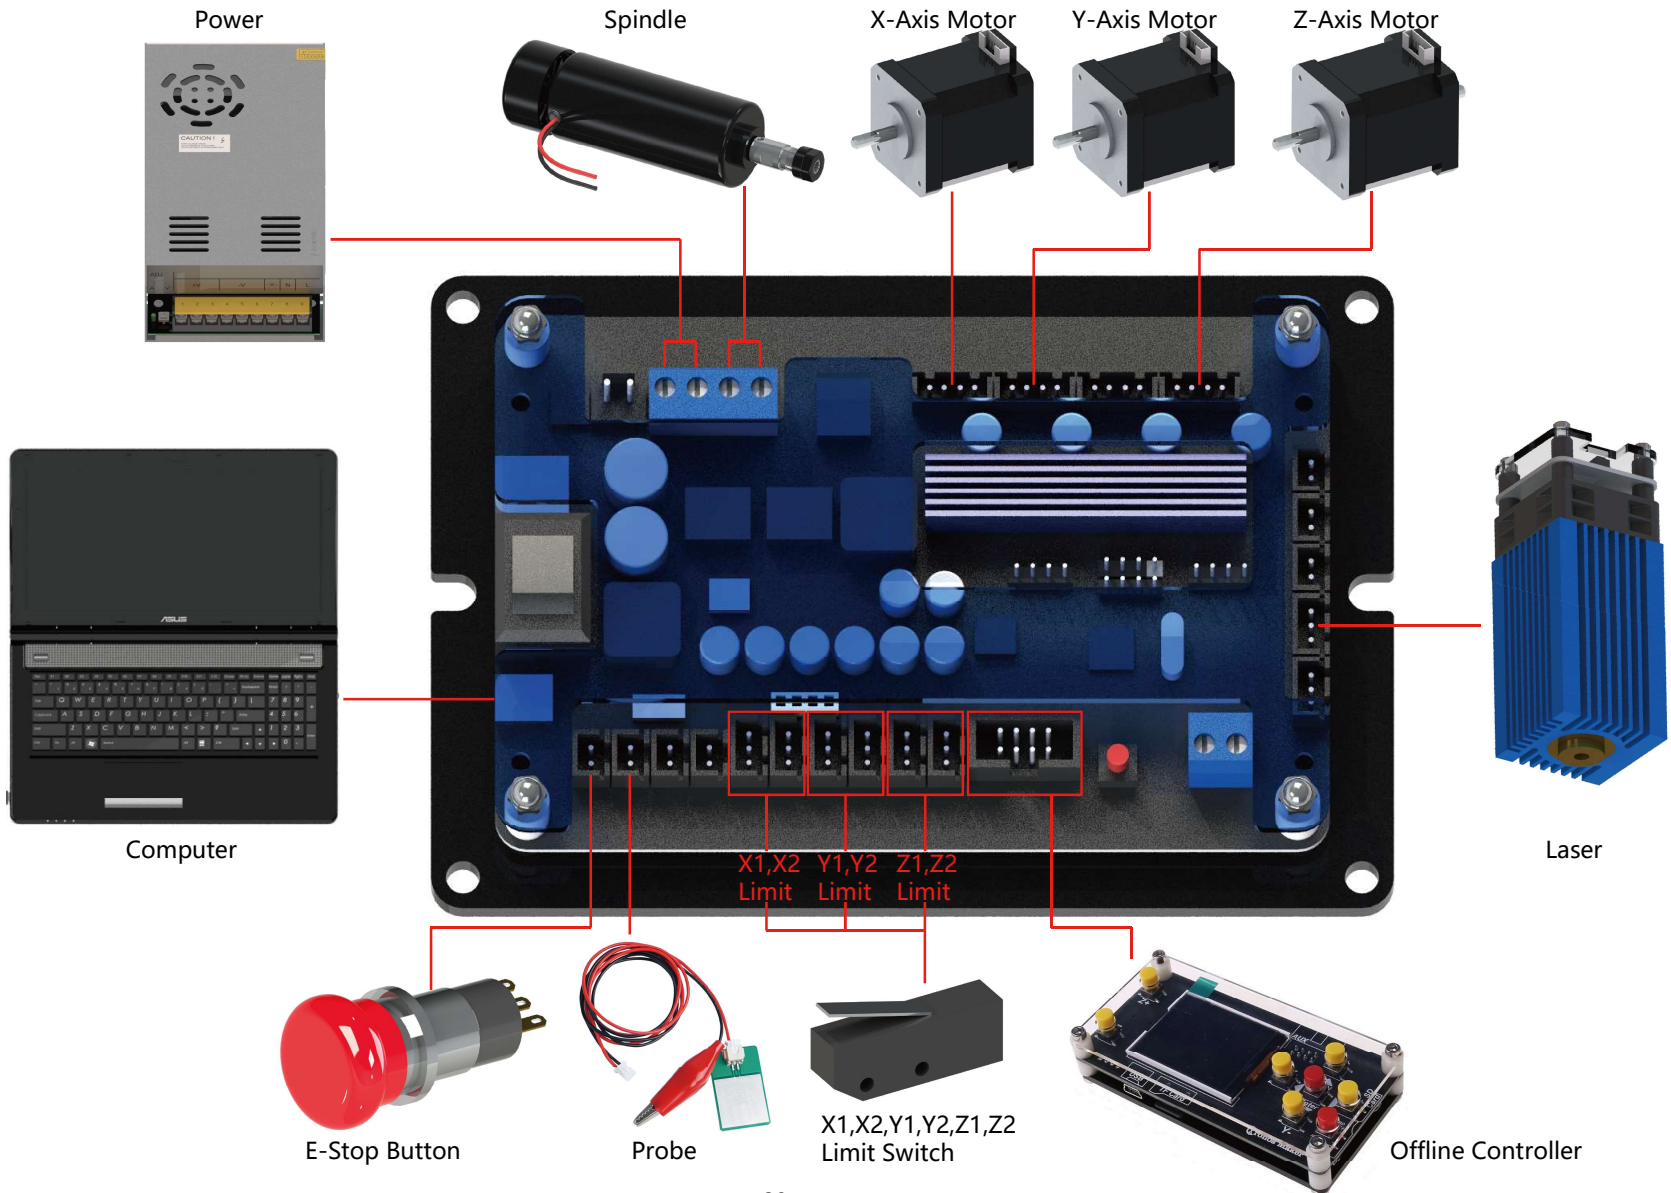

Wiring Diagram

